


Address:
United Arab Emirates
Tel:
Email:

Name: nolmns.com Phone: 056 440 4640

Received By

Make FORD
Model 1967 MUSTANG
Plate # 8417 DUBAI
Chassis/Vin #
Mileage 81553 ~~0~~ MILES
Registration Exp.
Received T/D
Delivered T/D

Please ensure that you removed all personal belongings from the vehicle. The garage will not be responsible for any missing items.

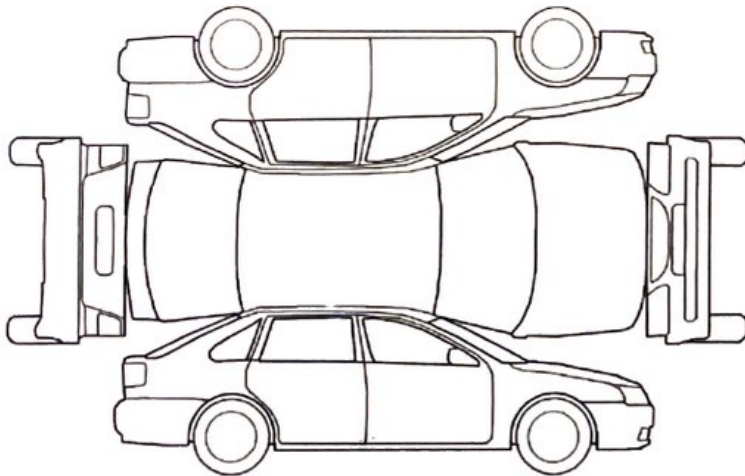

Comments:

WHEEL RIMS BOLT PATTERN MODIFIED
NEED SPIDIOT RING,
CLUTCH TOO HIGH
WINDOW GLASS NOT FULLY CLOSE
BONNET LOCK PIN LEFT MISSING



We do not accept any responsibility for any damage/scratches reported/claimed without mutual inspection performed. T&C apply.

Client

Electrical Diagnosis

BOSCH

TEST REPORT
=BATTERY TEST=

GOOD & PASS


FLOODED
VOLTAGE: 12.73V

RATED: 550 IEC(=EN)


MEASURED: 553 IEC(=EN)

IR: 5.75mΩ

CRANKING POWER
100%



STATE OF CHARGE
100%



CLIENT:

TEST DATE:
2022/03/29
10:45:12

BY:

EBC AUTO SERVICE

BOSCH

TEST REPORT
=STARTER TEST=
CRANKING VOLTAGE
11.04V PASS

=CHARGING TEST=
LOAD OFF:
13.12V FAIL
LOAD ON:
13.24V FAIL

=DIODE RIPPLE=
0.13V PASS

CLIENT:

TEST DATE:
2022/03/29
10:47:15

BY:

EBC AUTO SERVICE

Overall Report

Exterior	Critical	Minor	OK	Engine	Critical	Minor	OK	Vehicle Half Raised	Critical	Minor	OK
Body Damage			/	Brake Fluid Cond.	/			Front Brake Pads			/
Headlights			/	Brake Fluid Leaks	/			Front Brake Rotors			/
Taillights			/	P/S Condition		/		Rear Brake Pads			/
Wipers			/	P/S Leaks		/		Rear Brake Rotors			/
Door Locks			/	Coolant Cond.			/	Parking Brake Pads		N/A	
Lubricate Hinges			/	Coolant Leaks	/			Brake Hose Cond.			/
Electric Tailgate			/	Engine Oil Cond.			/	Wheel Guards			/
Windows		/		Engine Oil Leaks	/			Wheel Bearing		/	
Interior	Critical	Minor	OK	Washer Fluid Level	N/A			Tire Pressure			/
Dash functions			/	Washer Fluid Leaks	N/A			Underbody	Critical	Minor	OK
Radio			/	Engine Hoses		/		Chassis Damage			/
Windows		/		Aux Belt		/		Exhaust			/
A/C & Heating		/		Timing Belt		N/A		Fuel Tank			/
Seatbelts			/	Air Filter Cond.	/			Fuel Lines			/
Airbags		NOT EQUIPPED		Coolant Radiator		/		Brake Lines			/
Sunroof		NOT EQUIPPED		A/C Condenser		/		Transmission			/
Interior Lights		NOT EQUIPPED		Cooling Fans		/		Front Differential		N/A	
Horn			/	Fuel Filter		/		Rear Differential	/		
Mirrors			/	Starter Motor		/		Driveshaft/Axles			/
Service History			/	Battery		/		FL Suspension	/		/
Headlining			/	Alternator Charging		/		FR Suspension	/		/
Locks			/	Wheels & Tires	Critical	Minor	OK	RL Suspension			/
Convertible Roof		N/A		Front Left		/		RR Suspension			/
Tool Kit			/	Front Right		/		Road Test	Critical	Minor	OK
Other Electrical Equip.		/		Rear Left		/		Abnormal Noises			
Other	Critical	Minor	OK	Rear Right		/		Acceleration			
Keys			/	Spare		/		Transmission/Shift			
Registration			/	Compressor		/		Clutch			
License Plates			/	Tire Sealant		/		Gauges			

Tire Check	Thread Depth, mm			Pressure	Manufacturer/Model	Size	Rim	Index
	Inner	Middle	Outer					
Left Front	5mm	5mm	5mm		COOPER 4020	275/60	15	98T
Right Front	5mm	5mm	5mm		COOPER 4020	275/60	15	98T
Right Rear	5mm	5mm	5mm		COOPER 0621	245/60	15	180T
Left Rear	5mm	5mm	5mm		COOPER 0621	245/60	15	180T
Spare								

Battery Check			
Brand	Type (Wet/AGM/Lithium/Carbon)	Date	Ah Rating
EMERGIZER	WET / EN		

Technician Signature / Date