


mysyara Multi-Point Vehicle Inspection

MySyara Auto Care LLC.
 Head office: 1301, Palace Tower, Dubai Silicon Oasis, Dubai
 Workshop: DME, Al Qouz, Dubai
 United Arab Emirates
 Tel: +971 52 212 1322
 Email: support@mysyara.com

Name: nolmns.com	Phone: 056 440 4640
------------------	---------------------

Received By	HADI HASAN
Make	FORD
Model	MUSTANG (1966 - CLASSIC)
Plate #	N/A
Chassis/Vin #	6F087143964
Mileage	N/A
Registration Exp.	N/A
Received T/D	27/01/22
Delivered T/D	02/11/22

Please ensure that you removed all personal belongings from the vehicle. The garage will not be responsible for any missing items.

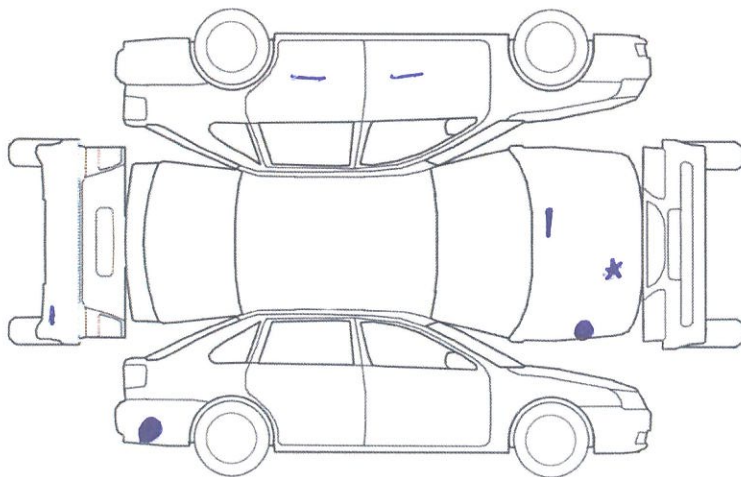

- Comments:
- Left Side Both Doors Scratched (Very Minor) -
 - Bonnet (Minor Scratched) -
 - Bonnet Paint Peeled (Minor) •
 - Bonnet Paint Cracking (Minor)*
 - Rear Right Fender Paint Peeled (Minor) •
 - Rear Bumper very minor scratch (need polish) •



Mechanical and visual inspection

We do not accept any responsibility for any damage/scratches reported/claimed without mutual inspection performed. T&C apply.

Client

Description	Minor	Bad	Critical
• ENGINE IS NOT CORRECT FITMENT	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
(Engine Replaced → as per car specification C5AE is required, while the engine is D4AE-AA).	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
• SUSPENSION IS SCRATCHING RIM	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
(Lower arm touching to the Rims (Front)).	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
• REAR DIFFERENTIAL LEAKING.	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
(Leaking and Minor rusting).	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
• Exhaust header need Modification	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
• Steering rack is not correct fitment	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
• Hoses → Engine, Radiator, Brakes, Fuel.	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
• Brakes → Brake Booster	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
• Fan belt, tensioner, idler	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
• Propeller shaft	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
• CHASSIS: Minor rust but not effecting surface.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
NOTE: NEED TO DO THIS WORK FIRST,	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
AFTER THIS A TEST DRIVE WILL	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
BE TAKEN. WE WILL UPDATE	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
ADDITIONAL WORK REQUIRED.	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
MECHANICAL AND VISUAL INSPECTION:	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Underbody of the car have minor rusting but	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
no damage found. Recommended to do Rustproofing.	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

Overall Report

Exterior	Critical	Minor	OK	Engine	Critical	Minor	OK	Vehicle Half Raised	Critical	Minor	OK
Body Damage		✓		Brake Fluid Cond.	✓			Front Brake Pads	✓		
Headlights			✓	Brake Fluid Leaks	✓			Front Brake Rotors		✓	
Taillights			✓	P/S Condition	✓			Rear Brake Pads	✓		
Wipers	✓			P/S Leaks	✓			Rear Brake Rotors		✓	
Door Locks	✓			Coolant Cond.	✓			Parking Brake Pads	✓		
Lubricate Hinges				Coolant Leaks	✓			Brake Hose Comd.	✓		
Electric Tailgate		N/A		Engine Oil Cond.	✓			Wheel Guards			✓
Windows		✓		Engine Oil Leaks	✓			Wheel Bearing			✓
Interior	Critical	Minor	OK	Washer Fluid Level	✓			Tire Pressure		✓	
Dash functions	✓			Washer Fluid Leaks	✓			Underbody	Critical	Minor	OK
Radio	✓			Engine Hoses	✓			Chassis Damage		✓	(Minor)
Windows		✓		Aux Belt	✓			Exhaust	✓		
A/C & Heating	✓			Timing Belt	✓			Fuel Tank		✓	
Seatbelts			✓	Air Filter Cond.	✓			Fuel Lines	✓		
Airbags		N/A		Coolant Radiator	✓			Brake Lines	✓		
Sunroof		N/A		A/C Condenser	✓			Transmission	✓		
Interior Lights	✓			Cooling Fans	✓			Front Differential	✓		
Horn	✓			Fuel Filter	✓			Rear Differential	✓		
Mirrors	✓			Starter Motor	✓			Driveshaft/Axles	✓		
Service History	✓			Battery	✓			FL Suspension	✓		
Headlining		✓		Alternator Charging	✓			FR Suspension	✓		
Locks		✓		Wheels & Tires	Critical	Minor	OK	RL Suspension	✓		
Convertible Roo ²		✓		Front Left			✓	RR Suspension	✓		
Tool Kit		N/A		Front Right	✓			Road Test	Critical	Minor	OK
Other Electrical Equip.		N/A		Rear Left				Abnormal Noises	TEST DRIVE		
Other	Critical	Minor	OK	Rear Right			✓	Acceleration	NOT DONE		
Keys				Spare			✓	Transmission/Shift			
Registration				Compressor		N/A		Clutch			
License Plates				Tire Sealant		N/A		Gauges			

Tire Check	Thread Depth, mm			Pressure	Manufacturer/Model	Size	Rim	Index
	Inner	Middle	Outer					
Left Front				FLAT	NEXEN	235	40	18
Right Front				OK				
Right Rear		OK		OK	2021			
Left Rear				OK				
Spare				OK				

Battery Check			
Brand	Type (Wet/AGM/Lithium/Carbon)	Date	Ah Rating
BOSCH			



Technician Signature / Date

70+ photos from the Inspection conducted by MySyara at Bright Spark Auto Repairing can be found here:

<https://photos.app.goo.gl/yv73icRV42HWpR3JA>